



APPLICATION OF FIRST PLY FLASHING

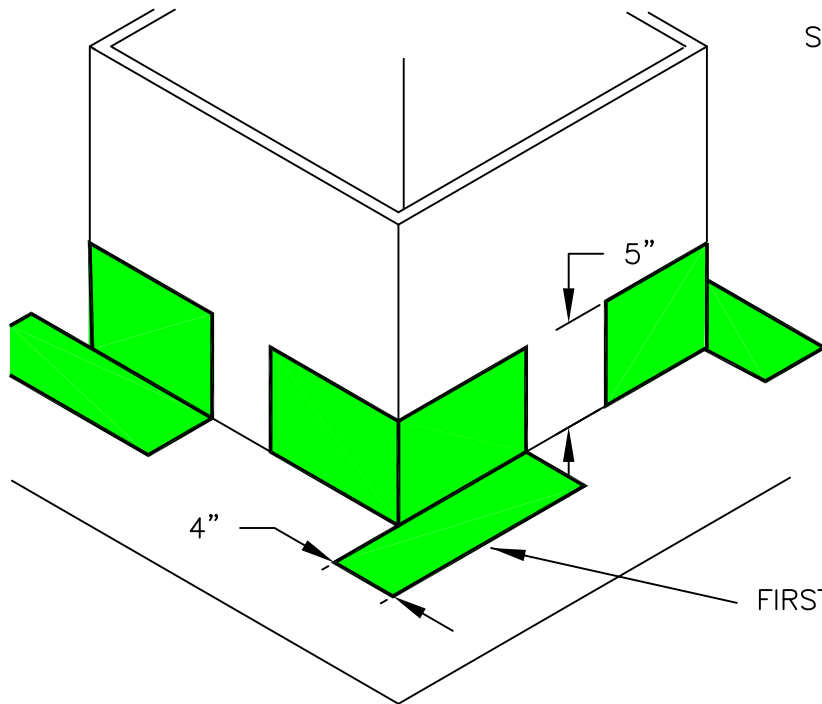

STEP 7: COAT THE RECTANGULAR PENETRATION WITH ADHESIVE 6" UP THE VERTICAL AND 6" ONTO THE HORIZONTAL, IF APPLICABLE.

PLACE THE FIRST PLY BOX CUT ONTO THE CORNER. 5" SIDE UP THE VERTICAL AND THE 4" SIDE OUT ONTO THE HORIZONTAL. PRESS THE PLY IN FIRMLY INTO PLACE. TOP COAT LIGHTLY WITH ADHESIVE.

FIRST PART/FIRST PLY

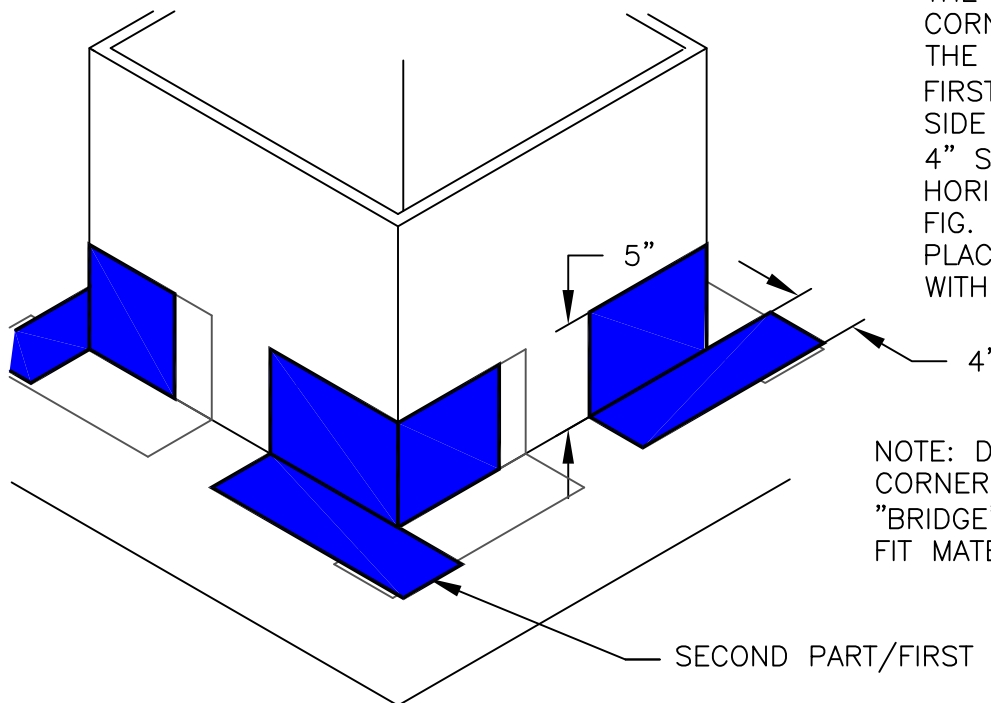

STEP 8: PLACE THE SECOND PART TO THE FIRST PLY ONTO THE CORNER THE OPPOSITE OF THE FIRST PART OF THE FIRST PLY. PLACE THE 5" SIDE UP THE VERTICAL AND 4" SIDE ONTO THE HORIZONTAL AS SHOWN IN FIG. 8.1. PRESS FIRMLY INTO PLACE. TOP COAT LIGHTLY WITH ADHESIVE.

NOTE: DO NOT ROUND CORNERS. DO NOT "BRIDGE" CORNERS. ALWAYS FIT MATERIAL TIGHTLY.

SECOND PART/FIRST PLY

FIG. 8.1

NOTE: LAURENCO PMMA LIQUID FLASHING MAY BE UTILIZED IN LIEU OF MEMBRANE FLASHING.